

## 2008 INFINITI G37 JOURNEY

## Vehicle Inspection Report

Information		VIN #: JNKCV64E48M118160	Stock No : 0101
Motorized type:	CARS & TRUCKS & VANS	Body Style:	COUPE
Year:	2008	Doors:	2 DOORS
Make:	INFINITI	Top Style:	NOT SPECIFIED
Model:	G37	Interior Type:	LEATHER
Trim:	JOURNEY	Fuel Type:	GASOLINE
Free text:	3.7L V6 5-SPEED AUTO...	Engine:	3.7L V6
Title:	USED	Transmission:	5 SPEED AUTOMATIC
Title Status:	NOT SPECIFIED	Drive Type:	ALL WHEEL DRIVE
Titled In:	NOT SPECIFIED	Audio:	AM/FM/SATELLITE /CD
Odometer:	97,884 MI	Interior Color:	BLACK
Exterior Color:	GRAY		

## Image Gallery



## Location &amp; Contacts

Address:		Dealer/Seller Name:	ART SLINGSHOT
City:		Contact Person Name:	
State:		Physical Location:	AT AUCTION
Zip/Postal Code:		Inspection Company ID:	ABCORL
Phone:		Facilitated Location:	FL - MANHEIM ORLANDO
Email:		Address:	

## Options

Comfort:	Cruise Control
Drive Train:	Aluminum/Alloy Wheels, Power Tilt and Telescopic Steering Wheel, Tire Pressure Monitoring System
Exterior:	Rear Spoiler
Interior:	Climate Control, DVD Entertainment System, Heated Seats, Memory Seat(s), Power Mirrors, Rear Defroster, Satellite Radio System
Other Features:	4 Passenger Seating, A/C, ABS Brakes, Auxiliary Pwr Outlet, Front Reading Lamps, Power Locks, Power Trunk Release, Pwr Steering, Rear Defrost, Rear Seat Audio Controls, Tire Pressure Monitor System, Trip Counter, US EPA Label
Safety:	Anti-Lock Brakes, Drivers Side Airbag, Passenger Side Airbags, Traction Control
Seats:	Leather Seats, Power Seats
Windows:	Power Windows

Customer Initial \_\_\_\_\_/

Dealer/Auction Initial \_\_\_\_\_/

Transport Initial \_\_\_\_\_/

# Vehicle Condition

## Overall

Frame Damage:	YES	Salvage:	YES
Sold AS IS:	YES	Odor:	NONE
Manuals:	NOT PRESENT	Inspection Date:	MAY 30, 2014 - 12:35:22 PM
Inspected By:	JOHN SMITH	Grading:	ARRAY (EXTRA CLEAN)

## Tires

Extra Clean Clean Average Below Average Rough Extra rough

RIM SIZE: 18

TIRE TEMPLATE: 225/50

Detail	Tread	Manufacturer	Status	Tire Template	Rim Size	Replacement/Tire Cost, \$
Front Left	4/32"	dunlop	normal	225/50	18	0.00
Front Right	4/32"	dunlop	normal	225/50	18	0.00
Rear Left	4/32"	dunlop	normal	225/50	18	0.00
Rear Right	4/32"	dunlop	normal	225/50	18	0.00
Spare	n/a	Not Specified	n/a	225/50	18	0.00

Subtotals of Tires Cost \$ 0

## Keys

Type	Status	Quantity	Comments	Replacement Cost, \$
Master	Present	1	Not Specified	

Images

Subtotal of Keys: \$0

## Exterior Details

Extra Clean Clean Average Below Average Rough Extra rough

Detail	Condition	Severity	Value	Flat Rate, \$	Material, \$	Labor, Hrs	Paint, Hrs	Metal, Hrs	Frame, Hrs	Estimated Repair, \$
Hood	Bent	10" or more	0.5	-	-	-	-	-	-	-
Images										
Rear Bumper	Dent/Paint Dmg	10" or more	1.7	-	-	-	-	-	-	-
Images										
Front Bumper	Missing	replacement required	0.0	-	-	-	-	-	-	-
Images										


Customer Initial \_\_\_\_\_/

Dealer/Auction Initial \_\_\_\_\_/

Transport Initial \_\_\_\_\_/

Right Fender	Dent/No Paint Dmg	10" or more	3.0	-	-	-	-	-	-	-
Images										
Right Quarter Panel	Collision Damage	10" or more	0.0	-	-	-	-	-	-	-
Images										
Deck Lid	Scratch Heavy	10" or more	2.0	-	-	-	-	-	-	-
Images										
Right Front Door	Collision Damage	10" or more	0.0	-	-	-	-	-	-	-
Images										
Left Rear Door	Dent/Paint Dmg	6" to 7"	2.1	-	-	-	-	-	-	-
Images										
HeadLight	Broken	replacement required	0.0	-	-	-	0.25	0.5	-	52.50
Images										
<b>Subtotal of Exterior Cost: \$52.50</b>				-	-	-	0.25	0.50	-	52.50

- Extra Clean
- Clean
- Average
- Below Average
- Rough
- Extra Rough
- Not Defined

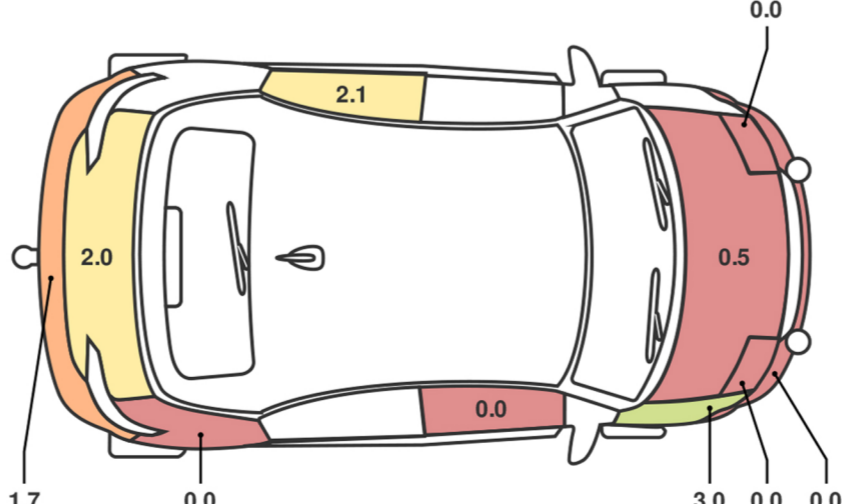


Customer Initial \_\_\_\_\_ /

Dealer/Auction Initial \_\_\_\_\_ /

Transport Initial \_\_\_\_\_ /

Detail	Condition	Severity	Value	Flat Rate, \$	Material, \$	Labor, Hrs	Paint, Hrs	Metal, Hrs	Frame, Hrs	Estimated Repair, \$
Steering Wheel	Scratch Light	1" to 2"	4.9	-	-	-	-	-	-	-
Images										

Interior	Right Front Seat	worn	9" to 10"	4.1	-	-	-	-	-	-	
Images											
Interior	Left Rear Seat	worn	replacement required	1.5	-	-	-	-	-	-	
Images	No images										
Interior	Right Rear Seat	worn	replacement required	1.5	-	-	-	-	-	-	
Images	No images										
Interior	Radio	broken	2" to 3"	2.6	-	-	-	0.25	-	17.50	
OBD Diagnostic Result: U0262 - Lost Communication With Audio Amplifier B											
Images	No images										
Interior	Lamp	broken	replacement required	0.0	-	-	-	-	-	-	
Images	No images										
<b>Subtotal of Interior Cost: \$17.50</b>					-	-	-	-	0.25	-	17.50

Section	Detail	Condition	Severity	Value	Flat Rate, \$	Material, \$	Labor, Hrs	Paint, Hrs	Metal, Hrs	Frame, Hrs	Estimated Repair, \$
Mechanics	Exhaust	NOT SPECIFIED	NOT SPECIFIED	-	-	-	-	-	-	-	-
OBD Diagnostic Result: P20CB - Exhaust Aftertreatment Fuel Injector A Control Circuit/Open											
Images	No images										
Mechanics	Emissions	NOT SPECIFIED	NOT SPECIFIED	-	-	-	-	-	-	-	-
OBD Diagnostic Result: P245E - Diesel Particulate Filter Pressure Sensor B Circuit											
Images	No images										
Mechanics	Transmission	NOT SPECIFIED	NOT SPECIFIED	-	-	-	-	-	-	-	-
OBD Diagnostic Result: P070C - Transmission Fluid Level Sensor Circuit Low											
Images	No images										
Mechanics	Engine	NOT SPECIFIED	NOT SPECIFIED	-	-	-	-	-	-	-	-
OBD Diagnostic Result: P069F - Throttle Actuator Control Lamp Control Circuit											
Images	No images										
Mechanics	Electrics	NOT SPECIFIED	NOT SPECIFIED	-	-	-	-	-	-	-	-
OBD Diagnostic Result: P0719 - Brake Switch B Circuit Low, P0721 - Output Speed Sensor Circuit Range/Performance											
Images	No images										

Mechanics	Climate Control	NOT SPECIFIED	NOT SPECIFIED	-	-	-	-	-	-	-	-
OBD Diagnostic Result: P06A0 - Variable A/C Compressor Control Circuit, P2515 - A/C Refrigerant Pressure Sensor B Circuit											
Images	No images										
Mechanics	Power Steering	NOT SPECIFIED	NOT SPECIFIED	-	-	-	-	-	-	-	-
OBD Diagnostic Result: U0134 - Lost Communication With Power Steering Control Module, U0328 - Software Incompatibility With Steering Angle Sensor Module											
Images	No images										
Mechanics	Clutch	NOT SPECIFIED	NOT SPECIFIED	-	-	-	-	-	-	-	-
OBD Diagnostic Result: P0805 - Clutch Position Sensor Circuit											
Images	No images										
<b>Subtotal of Mechanics Cost: \$0.00</b>				-	-	-	-	-	-	-	-
<b>Total Overall Repair Cost: \$70.00</b>				-	-	-	0.25	0.75	-	-	70.00

**On-Board Diagnostic Result:**

Code	Error Description
P069F	Throttle Actuator Control Lamp Control Circuit
P06A0	Variable A/C Compressor Control Circuit
P070C	Transmission Fluid Level Sensor Circuit Low
P0719	Brake Switch B Circuit Low
P0721	Output Speed Sensor Circuit Range/Performance
P0805	Clutch Position Sensor Circuit
P20CB	Exhaust Aftertreatment Fuel Injector A Control Circuit/Open
P245E	Diesel Particulate Filter Pressure Sensor B Circuit
P2515	A/C Refrigerant Pressure Sensor B Circuit
U0134	Lost Communication With Power Steering Control Module
U0262	Lost Communication With Audio Amplifier B
U0328	Software Incompatibility With Steering Angle Sensor Module

**Functional Inspection**

Component	Status	Comments
NOT SPECIFIED	NOT SPECIFIED	NOT SPECIFIED
Images	No images	

**Additional Comments**

GL/UNIBODY

Customer Initial \_\_\_\_\_  
 Dealer/Auction Initial \_\_\_\_\_  
 Transport Initial \_\_\_\_\_

Signature \_\_\_\_\_  
 Signature \_\_\_\_\_  
 Signature \_\_\_\_\_

Date \_\_\_\_/\_\_\_\_/\_\_\_\_\_  
 Date \_\_\_\_/\_\_\_\_/\_\_\_\_\_  
 Date \_\_\_\_/\_\_\_\_/\_\_\_\_\_